MARYLAND GEOLOGICAL SURVEY Merryman Hall The Johns Hopkins University Baltimore, Maryland 21218 (301) 235-0771

COUNTIES (MD/PA) _	WASHINGTON/FRANKLIN
M&D milestone no	103 (106)
MHT-HSI no.	WA-I-274
? PROTECTED ENDAN	IGERRIX/ANDSSANCE

FIELD SHEET: MASON & DIXON LINE, MARYLAND-PENNSYLVANIA BOUNDARY MARKER SURVEY

LOCATION: USGS 7.5'quadrangle Hagerstown 1953, polysing kyskta/moved/date slightly eastward 1962, 1971 bench mark/datenone observed & believed further eastward recently S/S State Line Road (PA 163), State Line, PA-MD. About 0.3 mile W of center of village of State Line, at point about 0.25 mile W of US 11 at the Line & 2' S of edge of State Line Rd pavement, opposite entrance to I-81, & about 2' above grade level in grassy bank S/S. Can be easily seen (& bumped into) from rd, all seasons. DIRECTIONS TO SITE: From M&D 102 (105): retrace Middle Woodland Parkway W about 0.4 mile to its end at Reid Rd; turn right (NW) & follow about 0.2 mile to its end at State Line Rd (PA 163): turn left (W) & stay with this rd through the village of State Line (over) DESCRIPTION/MEASUREMENTS: original/replication new date 1767; squared colitic limestone post, standing about 1 above ground; P on N/S, M on S/S ll%" wide x 16" high; P & circle panel visible but chipped; fluting & margins gone; surface pocked; edges & corners chipped l2" wide x 11" high; some fluting discernible; no margins remain; chips all edges & corners N face (PA): E face: 124" wide x 7%" high; M clear & intact, circle panel chipped; no fluting or margins remain S face (MD): W face: ll¾" wide x ll" high; no fluting or margins remain; 5 + 1 / L C cut into face; chips all edges & corners; weathered no planes or fluting remain; pocked, scratched, weatherworn; chips top: none indicated on maps: none observed

CONDITION OF MARKER/FOUNDATION: excellent/good/hair/deteriorated/ruins/whexpered 1900-03 Resurvey notes (order no.106), as in MGS Vol. 7, 1908, p. 90

106. Milestone No. 103, M. & D., 1767. This monument was found lying on the ground on the south side of the road leading from Middleburg to Mason and Dixon station on the Cumberland Valley R.R. The road runs along the (over)

1950 Inspection notes (present order no. 104, photo no. 103) as in Bayliff, 1959, Appendix C, p. 105

106. Original monument in fair condition; chipped on southeast and southwest corners. Lettering slightly weathered.

1979-81 Inspection notes: order no. 103 (100; photos/negatives/slides no.103(106) 103 (106). Original M&D milestone of 1767 relocated slightly to east and reset 1902, believed recently shifted again; in fairly good condition, firmly set.

Letters clear but chipped; all surfaces scarred, chipped and weathered.

SURROUNDING PROPERTY OWNERS (MD/PA): hames, addresses, phones

MD: tax map 10, block , P. 57, deed 581 / 220, acres 110.42

J. Allen Clopper, Breeze Hill Farm, Box 198, Middleburg, MD 21768

PA: tax map , block , P. , deed / , acres Phone: 301/733-7777

RECORDED BY: names, addresses, phones, dates Alice Martin 10/12/80

14308 Mount Ave., Phoenix, MD 21131 Phone: 301/472-2128
Assisted by Clyde E. Martin

Also see: reverse side X , B&W photos X , negatives X , color slides X , maps X . MHT-HSI form , other

DIRECTIONS TO SITE, continued

& past US 11, about 0.5 mile to entrance to I-81 (on N/S) & Breeze Hill Farm lane entrance & milestone (on S/S). Park here on rd shoulder. No permission needed from anyone to record stone, which appears to be on rd R/W.

CONDITION OF MARKER/FOUNDATION, continued

1900-03 Resurvey notes:

boundary and there was a slight cut at the point where the stone was found, which probably caused it to be washed out. For its better preservation in the future, the monument was placed on the line at a point a few yards to the eastward of its former position. It now stands on a solid ledge in the entrance to a farm lane, on the south side of the line road.

NOTES

The present location is now on the E/S of the Breeze Hill Farm lane (rather than on the W/S as shown on the quadrangle and 1900-03 Resurvey engineer's map. Ralph Donnelly (CE of Hagerstown/Hancock) believes the SHA (or interstate) relocated this at the time the entrance to I-81 was developed. MGS will want to contact both property owner and state (or other)agency concerning this shift, and determine whether it is still on the Line and securely set.

Anywhere along this stretch is an unfortunate location, very close to increasing traffic and vulnerable to vandalism. MGS will want to erect some kind of witness post (when site is verified), preferably sturdy enough for protection from vehicles.

B&W PHOTOS/NEGATIVES

5x7 NW corner (1980.23.31), Alice Martin 10/12/80

5x7 SE corner (1980.23.33), "

3/2x5 View E: along State Line Rd (PA 163), showing stone & Breeze Hill Farm lane (1980.23.29), Alice Martin 10/12/80

3½x5 View S across State Line Rd toward stone & farm lane (1980.23.35), Alice Martin 10/12/80

COLOR SLIDES

2x2 NW corner (1980.26.29), Alice Martin 10/12/80


2x2 SE corner (1980.26.32), "


2x2 View SW across State Line Rd, showing stone & Breeze Hill Farm lane (1980.26.33), Alice Martin 10/12/80

MAPS

USGS 7½' topographic quadrangle section 1900-03 Resurvey engineer's map (Plate XXXIX), updated MD tax map section

OTHER

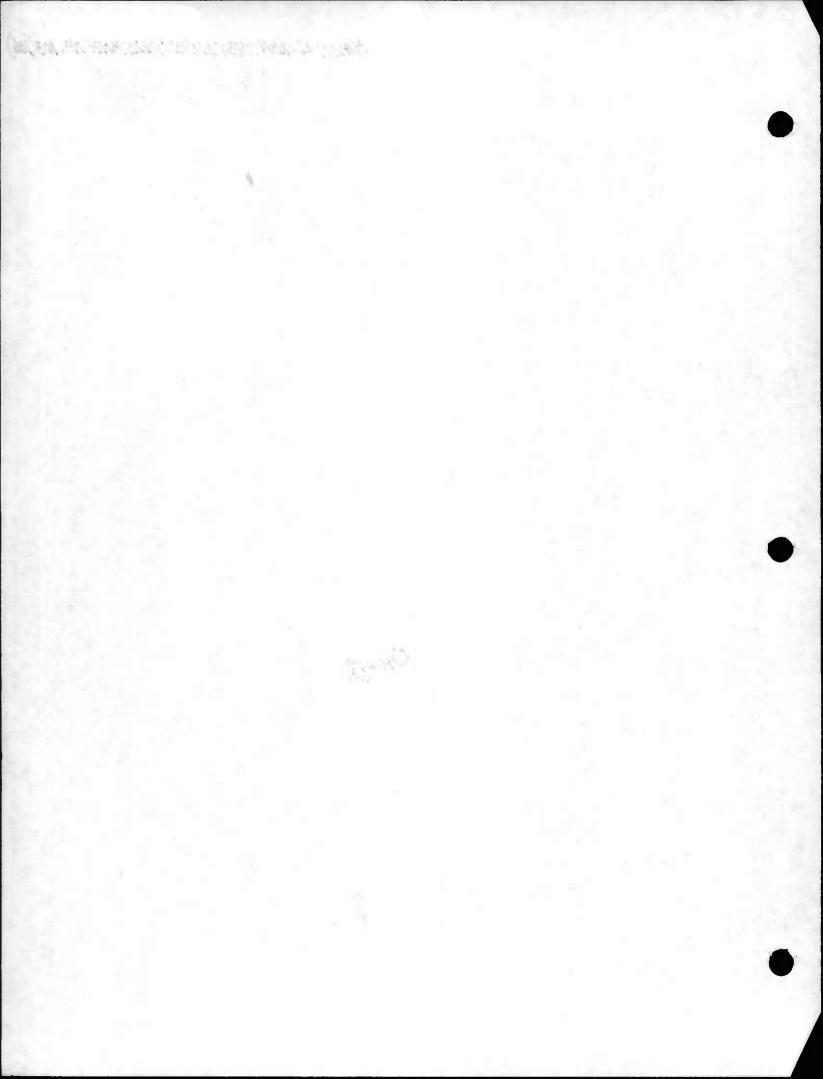

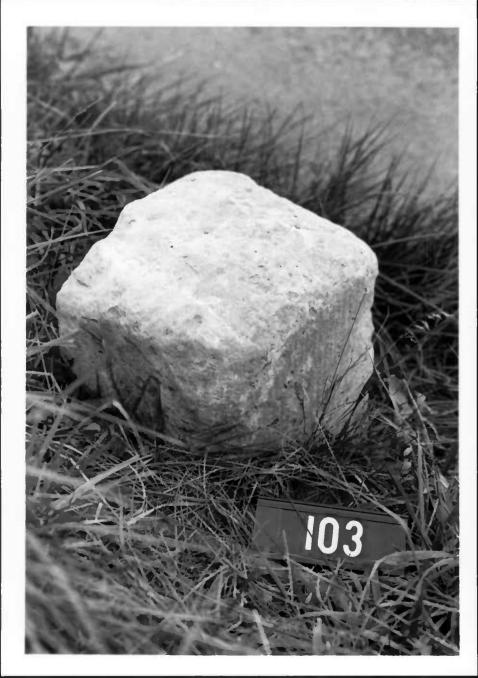

MASON C WIXON WEST LINE! MILESTLY (108)

IN SI PARTI 163 RID, STATE LINE, DA.

SE CORREL (M/-)

PHOTO: ALICE MARTIN (1980-23.3: 10/2 R)



MASON & DIXON WEST LINE: MILESTONE 103(106)

PHOTO: ALKE HARTIN (1984.23,35) 10/12/80



MASON STUXON WEST LINE: MILESTONE 103(106)

PHOTO: ALICE HARTIN (1990. 23.31) 10/12/80

NORTH

PENNSYLVANIA



WA-I-274 1165 MASON EDIXONI WEST LINE: MILESTONE 103 (106) LOCKING E ALENG PA. 163 TOWARD STONE

PHOTO: ALICE MARTIN (1980.23.29) 10/12/80

STENE 6